

Vess A2000 Series

SR1.3 Release Notes

Release Notes Document

Version: 5.0

Date: 2015/11/06

Copyright © 2015, PROMISE Technology, Inc.
All Rights Reserved

Revision History

Revision	Date	Release Label	Release Version	Notes
1.0	2013/03/29	Windows FCS	1.00.0000.53 (all) 0.00.0000.98 (BIOS)	
2.0	2014/02/10	Windows SR1	1.02.0000.00 (all) 0.01.0000.06 (BIOS)	
3.0	2014/08/06	Windows SR1.1	1.02.0000.29 (all) 0.01.0000.06 (BIOS)	
4.0	2015/03/05	Windows SR1.2	1.03.0000.01 (all) 0.02.0000.07 (BIOS)	
5.0	2015/11/06	Windows SR1.3	1.03.0000.14 (all) 0.02.0000.07 (BIOS)	

Table of Contents

1.	CONTENTS FOR THIS RELEASE	4
2.	RELEASE INFORMATION	4
2.1	RELEASE CONTENT	4
2.2	VERSION	4
2.2.1	CURRENT VERSION	4
2.2.2	LAST VERSION	4
2.3	HIGHLIGHTS IN THIS RELEASE	4
2.3.1	FW RELATED FIXES	4
2.3.2	SW RELATED FIXES	4
2.4	ERRATA	5
2.4.1	SR1 (1.02.0000.24)	5
2.4.2	SR1 (1.02.0000.00)	5
2.4.2	FCS (1.00.0000.53)	6
3	NOTES	6

1. Contents for This Release

SR1.3 Windows image version v1.03.0000.14 is for Vess A2000 series products, and the image can be used with the following models:

1. Vess A2200, A2200s, A2600, A2600s

2. Release Information

2.1 Release Content

The SR1.3 release includes two types of format for use

1. Installation Image v1.03.0000.14
2. Driver Package v1.03.0000.14

2.2 Version

2.2.1 Current Version

Vess A2000 SR1.3 Release: v1.03.0000.14

2.2.2 Last Version

Vess A2000 SR1.2 Release: v1.03.0000.01

2.3 Highlights in this release

1. Fix multiple drives dead issue on VA2600.
2. Change the default setting of Synchronization to be enabled.
3. Support extension RAID card to install OS on RAID1 disk.
4. Integrate KB3033929 to update package to support new digital signature of RAID driver for Windows 7 and Windows Server 2008.

2.3.1 FW Related Fixes

1. RB-219773: Fix multiple drives dead issue on VA2600.
2. RB-218693: Fix the LED issue when delete logical drive during rebuilding.

2.3.2 SW Related Fixes

1. RB-219202: Update Apache (2.4.16) and OpenSSL (1.0.1p) to enhance the network security.
2. RB-218689: Clear the old Windows log when reseal Windows image.
3. RB-221002: Fix memory leakage issue of SNMP.

2.4 Errata

2.4.1 SR1.3 (1.03.0000.14)

ID	Errata	Workaround
1	Promise RAID Monitor service does NOT remove after uninstall driver package.	Please type command "sc delete raidmon" in Windows command prompt to remove the service manually. There is no functional issue, even user does NOT remove it manually.
2	Global RAID status LED does NOT blink red when both two M.2 devices failed with RAID1 on Extension RAID card.	Need to take action to replace defective M.2 device when system indicate Red/Amber LED along with other notifications before second M.2 defect.

2.4.2 SR1 (1.02.0000.24)

ID	Errata	Workaround
1	On-board Ethernet chip doesn't support Wake-on Lan feature on Windows Server 2012.	Please use external Ethernet PCIE card which support Wake-on Lan feature on Windows Server 2012.

2.4.3 SR1 (1.02.0000.00)

ID	Errata	Workaround
1	COM1 and COM2 maybe converse with physical COM port.	Please use windows command "change port" to check the com port mapping status. If "COM1=\Device\Serial0" and "COM2=\Device\Serial1", then the mapping is no problem. But if "COM1=\Device\Serial1" and "COM2=\Device\Serial0", then the mapping is converse. Please connect the physical cable to converse port number.
2	Slow I/O access when applying USB2.0 flash drive onto the front panel USB3.0 ports, cases like Ex: 1. Copy huge file. 2. Install OS.	1. Use compatible USB3.0 flash drive to the front panel USB ports to avoid interoperability problems 2. Use any of the rear USB ports
3	USB 3.0 flash drive might downgrade to USB 2.0 in front	Use rear USB3.0 ports to ensure device running at full speed.

	panel USB ports.	
4	Pagefile Wizard can't have enough authority to get some system information.	<p>This only happens in case of install Standard Windows w/o UAC with additional Promise RAID driver.</p> <p>The UAC (User Account Control) setting might prevent the Pagefile Wizard from accessing some OS information if the setting isn't correct, and shows warning message. (The warning message won't affect system normal operation)</p> <p>To avoid, please change the UAC setting to "not notify" before you install or update the driver package.</p> <p>Please refer to below link to change the setting, http://support.microsoft.com/kb/975787</p>
5	WebPAMProE runs conflict with the WebPAM of SuperTrak EX8768	<p>Do not install SuperTrak EX8768's management software WebPAM in the Vess A2000 series as it creates conflict to the embedded management software WebPAM ProE. Please use BIOS utility to configure the card's RAID setting.</p>

2.4.2 FCS (1.00.0000.53)

ID	Errata	Workaround
1	Copy big file size more than 1GB through front panel USB3.0 port to/from attach USB2.0 Flash device of Vess A2200 may not success for compatibility reason. Please refer USB compatibility list for USB2.0 flash device to USB3.0 port	<ol style="list-style-type: none">1. Use compatible USB2.0 flash drive or2. Use USB3.0 flash drive or3. Use rear USB3.0 port for USB 2.0 flash

3 Notes

None